

DOCUMENT RESUME

ED 432 894

EF 005 577

AUTHOR Gibbs, Tony
TITLE Vulnerability Assessment of Selected Buildings Designated as Shelters: Grenada.
INSTITUTION Organization of American States, Washington, DC.; Consulting Engineers Partnership Ltd.; Agency for International Development (IDCA), Washington, DC.
PUB DATE 1998-00-00
NOTE 55p.; Funding by the USAID-OAS Caribbean Mitigation Project and the OAS-ECHO Project To Reduce the Vulnerability of School Buildings to Natural Disasters. Photographs will not reproduce well.
AVAILABLE FROM Web site:
<http://www.oas.org/en/cdmp/document/schools/vulnasst/gre.htm>
PUB TYPE Guides - Non-Classroom (055) -- Reports - Descriptive (141) -- Tests/Questionnaires (160)
EDRS PRICE MF01/PC03 Plus Postage.
DESCRIPTORS *Educational Facilities Improvement; Elementary Secondary Education; Foreign Countries; *Natural Disasters; Public Schools; Questionnaires; Surveys
IDENTIFIERS Caribbean; *Emergency Shelters; *Grenada

ABSTRACT

Educational facilities in the Caribbean often serve as shelters during natural hazards, but they often sustain as much damage as other buildings. This study investigated the physical vulnerability of schools, located in Grenada, to wind forces, torrential rain, and seismic forces in order to provide relevant local agencies with some of the input required for selection of properties for Caribbean Development Bank funding. Information tables list each school; its description and vulnerable areas; and its vulnerability ratings for wind, torrential rains, and seismic forces. Additional tables list each school followed by recommendations for improvements in order to upgrade the structure against natural hazards. A sample of the survey instrument concludes the report. (Contains eight references.) (GR)

* Reproductions supplied by EDRS are the best that can be made *
* from the original document. *

ED 432 894



**Vulnerability Assessment of Selected Buildings
Designated as Shelters
Grenada**

**Organization of American States
General Secretariat
Unit for Sustainable Development and Environment**

**USAID-OAS Caribbean Disaster Mitigation Project
OAS-ECHO Project to Reduce the Vulnerability of School Buildings to Natural
Disasters
1998**

**This report was prepared by
Tony Gibbs of Consulting Engineers Partnership Ltd.**



TABLE OF CONTENTS

1 INTRODUCTION

1.1 The Purpose of the Project

1.2 Terms of Reference

1.3 Natural Hazards in the Caribbean

1.3.1 Earthquakes

1.3.2 Volcanic Activity

1.3.3 Tsunamis

1.3.4 Hurricanes

1.3.5 Torrential Rains

1.3.6 Storm Surge

1.3.7 Landslide

2 INVESTIGATION PROCEDURE

U.S. DEPARTMENT OF EDUCATION
Office of Educational Research and Improvement
EDUCATIONAL RESOURCES INFORMATION
CENTER (ERIC)

☒ This document has been reproduced as
received from the person or organization
originating it.

☐ Minor changes have been made to
improve reproduction quality.

• Points of view or opinions stated in this
document do not necessarily represent
official OERI position or policy.

BEST COPY AVAILABLE

2.1 Briefing

2.2 Field Surveys

2.3 Desk Studies

3 RESULTS

3.1 Vulnerability to Hurricanes

3.1.1 General Observations

3.1.2 Aspects of Vulnerability

3.1.3 Summary of Results

3.2 Vulnerability to Torrential Rain

3.2.1 General Observations

3.2.2 Summary of Results

3.3 Vulnerability to Earthquakes

3.3.1 Multi-hazard Design

3.3.2 Differences Between Designing Against Earthquakes and Hurricanes

3.3.3 Aspects of Vulnerability

3.3.4 Summary of Results

4 GENERAL ISSUES

4.1 Impact of Hurricanes on Caribbean Schools

4.2 Hazards versus Disasters

4.3 Codes and Standards

4.4 The Regulatory Environment

4.5 Public Awareness

4.6 Vulnerability Surveys

4.6.1 Qualitative Assessment

4.6.2 Analytical Evaluation

4.7 Disaster Mitigation after the Event

4.8 Maintenance as a Tool for Mitigation

5 SUMMARY

5.1 Recommendations

5.2 Classes of Vulnerability

5.3 Further Work

Appendix I Survey Forms

- Hurricane Vulnerability Assessment
- Seismic Vulnerability Assessment - Part I
- Seismic Vulnerability Assessment - Part II

Appendix II Technical Paper

Hassan, Ahmed F. and Sozen, Mete A., *Seismic Vulnerability Assessment of Low-Rise Buildings in Regions with Infrequent Earthquakes*, ACI Structural Journal, January - February 1997

Appendix III Photographs of Selected Buildings in Grenada

1 INTRODUCTION

1.1 The Purpose of the Project

Throughout the world, including the Caribbean, natural hazards cause as much damage to educational facilities as they do to buildings of less importance. This is regrettable but it is also avoidable. Educational facilities deserve special attention because of their roles during the active periods of storms and also as post-disaster assets.

It is traditional for schools to be used as hurricane shelters. It goes without saying, therefore, that the damage and destruction of schools would put the sheltered population at risk during severe storms. Also, damage and destruction of such schools would not facilitate the use of school buildings for temporary housing after hurricanes. The longer-term problem of loss of educational facilities is arguably even more severe. If the children are not at school the parents' work is often adversely affected (in part because of "baby-sitting" problems). There is also the inevitable disruption of the pupils' education.

It is often said that safe buildings may not be affordable, especially in relatively poor developing countries. This is a fallacy. Particularly with respect to hurricane resistance, safe buildings are not only technically feasible but also achievable at very modest cost. This thesis has been tested and confirmed on several occasions over the years.

The Caribbean Development Bank (CDB) proposes to assist its borrowing members in reducing the vulnerability of designated shelters to natural hazards. The initial screening of these designated properties is being carried out in some of the CDB member countries through the auspices of the Organisation of American States (OAS) using CDMP [1] and ECHO [2] funding.

It is recognised that the suitability of properties for use as emergency shelters depends on several factors other than structural safety. Some of these factors are location, size, water storage and supply, sanitary facilities, kitchen facilities, standby power and telecommunications within the facility and externally. Most of these issues are already being addressed by other agencies. The focus of this study is on the physical vulnerability of the built facilities to wind forces, torrential rain and seismic forces. This initial screening will provide the relevant local agencies with some of the input required for selection of properties for the follow-on, CDB-funded projects.

1.2 Terms of Reference

The portions of the overall Terms of Reference (ToR) relevant to the subject of the present report are:

Preliminary assessment and screening of properties identified by participating governments (Grenada in this case), for the purpose of classifying the properties with respect to their retrofit needs.

- The consultant will prepare a survey form to be applied by local engineers employed by the participating governments (Grenada in this case). The form will be applied to up to 20 properties per country (20 in the case of Grenada). The form will contain a section on wind resistance, amended from the WIND-RITE form of IPLR [3], and an earthquake resistance section, based on the work of Ahmed F Hassan (ACI Journal January-February 1997).
- The consultant will prepare a workplan for the application of the survey forms by the local

engineer(s). The local engineer(s) will be assigned by each participating country (Grenada in this case) to work with the consultant. The consultant will train the selected local engineers in the application of the forms and will periodically monitor the progress and quality in the application of the survey forms.

- The consultant will execute a field visit to each of the participating countries. The field visit will be planned and executed with the participation of the local engineers. Prior to the field visit, the consultant will review the completed forms.
- During these field visits, the consultant will continuously articulate the issues being observed in determining vulnerability; the relative importance of various factors such as location, geometry, materials of construction, detailing; the differences between wind and earthquake vulnerability; etc. For each of the participating countries (Grenada in this case), the consultant will develop a classification (screening) of all identified properties. The classification will achieve a broad-brush appreciation for the vulnerabilities of the individual buildings to wind and earthquake events and the suitability of the properties for inclusion in a CDB retrofitting project.

As articulated above, an important objective of this project is technology transfer and the broadening of the pool of "disaster mitigation" engineers in the region. Therefore, the active involvement of local engineers (assumed to be from the relevant public works departments) was essential.

1.3 Natural Hazards in the Caribbean

The primary natural hazards facing the islands of the Caribbean are earthquakes and hurricanes. Some of the islands are also subjected to instances of volcanic activity. There are also the related hazards of tsunamis and storm surge.

Torrential rains can also, by themselves, be considered natural hazards since they often occur without the concurrent occurrence of hurricanes and sometimes result in disastrous flooding of low-lying areas. Likewise, some landslides are naturally occurring, isolated events.

1.3.1 Earthquakes

All of the Commonwealth Caribbean countries, with the exceptions of Bahamas and Guyana, lie close to the known tectonic plate boundaries. The North American Plate is moving westward with respect to the adjacent Caribbean and South American Plates at a rate of approximately 2 centimetres per year. A moderate level of inter-plate activity is generated along these boundaries. Along the northern margin, including areas in the vicinities of Jamaica and the Virgin Islands, moderate earthquakes of shallow depth are generated. Near the plate boundaries there are also intra-plate earthquakes. In the northern Caribbean these intra-plate earthquakes are caused by internal deformation in a slab of the North American Plate. Concentrations of these earthquakes occur at depths of up to 200 kilometres.

Seismic events in the Eastern Caribbean are principally associated with a subduction zone at the junction of the Caribbean Plate and the North American Plate. The North American Plate dips from east to west beneath the Caribbean Plate along a north-south line just east of the main island arc. This leads to a moderate level of inter-plate seismicity. Superimposed on this is a pattern of intra-plate activity. There is a concentration of such activity in the Leeward Islands where the subduction of the Barracuda Rise imposes additional stresses on both the "subducted" North American Plate and the overriding Caribbean Plate. The earthquakes there are generally shallow. In the region north-west of Trinidad there is another concentration of earthquake activity where the strike of the plate boundary changes direction. These earthquakes are of intermediate depth.

Over the past forty-five years a considerable amount of research has been carried out on the seismicity of

the Caribbean by the Seismic Research Unit (SRU) of the University of the West Indies (UWI). The engineering community has been requesting more and more assistance from the SRU in interpreting the fundamental research and developing "code" values for seismic forces for use in structural design. The most recent published work in this field is that of SRU's former head, Dr John Shepherd, now at Lancaster University (England).

The Pan-American Institute of Geography and History (PAIGH) is based in Mexico City. The Geophysical Commission of PAIGH is the executing agency for a major project (funded by IDRC [4]) for preparing Seismic Hazard Maps for Latin America and the Caribbean and headed by Dr J G Tanner. Dr John B Shepherd participated in this project as the Caribbean specialist.

The final report and mapping from this project indicates that Grenada lies on the iso-acceleration line representing 150 gals [5]. This is the peak ground acceleration with a probability of non-exceedance of 90% in 50 years. The Caribbean Uniform Building Code (CUBiC) assigns a zone factor (Z) of 0.5 to Grenada, which is somewhat more severe than suggested by the PAIGH study. However, both of these references indicate a moderate earthquake hazard for Grenada.

1.3.2 Volcanic Activity

Several of the islands of the Eastern Caribbean are volcanic in origin. The volcanoes there are considered to be either active or dormant. Kick'em Jenny (just north of Grenada) is an active submarine volcano.

1.3.3 Tsunamis

A tsunami (or seismic sea wave or tidal wave) is a series of ocean waves generated by any large-scale, short-duration disturbance of the free surface of the ocean. The majority are related to tectonic displacements associated with earthquakes at plate boundaries. However, erupting volcanoes, landslides or underwater explosions can also generate tsunamis. In the open ocean, tsunamis may have wavelengths of up to several hundred miles but heights of less than 1 meter. Because this ratio is so large, tsunamis can go undetected until they approach shallow waters along a coast. Their height as they crash upon the shore mostly depends on the geometry of the submarine topography offshore, but they can be as high as 30 meters.

Kick'em Jenny was first identified by visual observation of a series of explosive eruptions in 1939. However, the first accurate bathymetric survey of the volcano was carried out in 1972 at which time the summit of the volcano was located at approximately 200 metres below sea level. Since then, a series of underwater eruptions has increased the height of the volcano by about 60 metres. This represents an average growth rate of about 4 metres/year.

Studies have suggested that a tsunami generated by a violent eruption at Kick'em Jenny would realistically reach heights over 7 metres on the north shore of Grenada within 5 minutes of the eruption. All the other islands of the Eastern Caribbean would experience waves ranging from 1.7 metres to over 5 metres in height.

A tsunami travels at an average velocity of 500 to 600 kilometres per hour rising to a maximum of 800 km/h. Therefore within one hour of a major occurrence at Kick'em Jenny, many of the islands of the Eastern Caribbean will be affected.

Kick'em Jenny therefore presents a significant hazard to Grenada, Carriacou and Petit Martinique and also to the rest of the Eastern Caribbean.

The sequence of a major eruption of Kick'em Jenny, without the provision of adequate warning or evacuation procedures, are potentially catastrophic for Grenada. This, however, is outside the scope of this report.

1.3.4 Hurricanes

Much is not known about the storms that occurred in the Caribbean in the years before the advent of Columbus. But, of course, the European did not bring hurricanes to the Caribbean. Indeed the very name is derived from the Mayan storm god *Hunraken* and the Arawak word *hurican*, which meant the devil wind. The greatest of all recorded hurricanes occurred from 10th to 18th October 1780. Nearly 20,000 people perished as the storm hit virtually every island from Tobago in the south-east through the Windward and Leeward Islands and across to Hispaniola and Cuba. In the last 60 years in the Caribbean another 20,000 people have lost their lives because of hurricanes.

The Caribbean lies in the North Atlantic Ocean, one of the six main tropical areas of the earth where hurricanes may develop every year. Within the 111 years between 1886 and 1996, approximately 1000 tropical storms have been recorded in the North Atlantic. About half of these attained hurricane strength.

The destructive potential of a hurricane is significant due to high wind speeds and torrential rains that produce flooding and occasional storm surges with heights of several feet above normal sea level.

The pattern in recent times has been a reduction of deaths and injuries (because of better warning systems and other preparedness activities) and an increase in property damage (because of commercially-driven unsuitable building practices and locations).

The Caribbean Uniform Building Code (CUBiC) assigns a reference pressure of 0.60 kPa ^[6] to Grenada. This is equivalent to a 10-minute sustained wind speed of 31.6 m/s (71 mph) or an equivalent 3-second gust speed of 47 m/s ^[7] (105 mph). These figures relate to a 50-year return period.

1.3.5 Torrential Rains

Although heavy rains often accompany hurricanes, severe rainfall events resulting in flooding are also, and frequently, associated with troughs and tropical depressions. The risk of flooding is therefore not restricted to, nor more likely to occur, during hurricane events.

Drainage systems and structures in the Caribbean are generally designed for rainfall events having return periods of 20 years. This means that such systems are likely to become overloaded and cause some degree of flooding when rainstorms are experienced with return periods greater than 20 years. No guidance on this is provided in CUBiC. However, consideration should be given to moving this common standard to a longer return period. Intensity-duration-frequency relationships for rainfall events are required for rational engineering analysis. These are available from the Caribbean Meteorological Institute for some Caribbean islands.

The damage caused by flooding depends on the type and elevation of facilities in the location. The results of flooding may range from the inconvenience of temporarily submerged driveways to the loss of equipment and finishes inside flooded buildings and consequential disruption of the functions.

Flooding has been the cause of many of the deaths and of much property damage as well. Clearly, location is critical when it comes to flood risk. Low-lying lands, river banks and lands adjacent to gullies are to be avoided if possible. If not, deliberate drainage measures must be taken. Usually this is a municipal responsibility, at least in terms of overall control, since what happens to one property can easily be affected

by a neighbour's actions.

The design of external works for shelter premises would include consideration of local flooding. It would not be practical to study the overall catchment area for the design of each particular site. However, some general appraisal of the adjacent areas should be carried out as input for the design of on-site drainage structures.

1.3.6 Storm Surge

Storm surge is associated with hurricanes and consist of unusual volumes of water flowing onto shorelines. Storm surge has been responsible for much of the damage caused by hurricanes, especially in large, low-lying coastal settlements.

Storm surge is a complex phenomenon which behaves quite differently from one shoreline to another. The several main components governing their behaviour are:

Astronomical Tide:	water levels due to tidal variation;
Initial Water Level:	elevated basin-wide water levels caused by larger storms;
Pressure Deficit:	elevated water levels caused by low pressure systems;
Inland Runoff:	raised water levels in rivers and sea outfalls due to prolonged rainfall;
Current Surge:	ocean currents caused by high winds leading to the "piling up" of shallow waters;
Wave Setup:	water accumulating from continuous trains of waves on breaking on the shoreline; and
Wave Action & Runup:	effect of actual waves superimposed on the above factors.

The increase in coastal settlement has put much of our economic investment at risk from sea damage. Future rises in sea level can only make this condition more acute. Storm surge caused by hurricanes causes the most dramatic damage. Waves cause damage without accompanying surge but they are also superimposed on storm surge.

As well as causing flooding and damage to coastal structures, storm surge may also precipitate flooding further inland through the blockage of the outfalls of drainage systems.

This is outside of the scope of the present exercise.

1.3.7 Landslides

Most landslides in Caribbean islands cannot be regarded as natural hazards since they are brought about by inappropriate farming practices although triggered by natural events. Another man-induced class of landslides is road construction in mountainous areas. Often the cut embankments are too steep for stability. Often the down-slope fills are unstable.

There are, however, a few situations where nature itself produces the events. This phenomenon is outside the scope of this report.

2 INVESTIGATION PROCEDURE

2.1 Briefing

On 9 April 1998 an initial briefing took place at the Western Main Road Project Office with Eng. Rubi Despaigne Benitez and Ms. Joyce Thomas-Calliste. The overall programme was explained and Consulting Engineers Partnership Ltd (CEP) delivered the survey forms to Eng. Rubi Despaigne Benitez.

The forms are:

- Hurricane Vulnerability Assessment
- Seismic Vulnerability Assessment - Part I
- Seismic Vulnerability Assessment - Part II

2.2 Field Surveys

The shelters to be surveyed were:

Individual Building and Code Number	Name	Location
SDRCS-01	St. David's R.C. School	St. David's
PRRCS-02	Pomme Rose R.C. School	St. David's
CRCS-03	Crochu R.C. School	St. David's
SGAS-04	St. Giles Anglican School	St. Andrew's
HCRCS-05	Holy Cross R.C. School	St. Andrew's
BGS-06	Belair Government School	St. Andrew's
PGS-07	Paraclete Government School	St. Andrew's
CGS-08	Calliste Government School	St. George's
HHSS-09	Happy Hill Secondary School	St. George's
BRCS-10	Beaulieu R.C. School	St. George's
SPGS-11	St. Paul's Government School	St. George's
SLRCS-12	St. Louis R.C. School	St. George's
SGS-13	South St. George Government School	St. George's
MRCS-14	Mt. Rose Comprehensive School	St. Patrick's
SPAS-15	St. Patrick's Anglican School	St. Patrick's
LGS-16	Loretto Government School	St. John's
CGS-17	Concord Government School	St. John's
SMSS-18	St. Mark's Secondary School	St. Mark's
DGS-19	Dover Government School	Carriacou
HGS-20	Hillsborough Government School	Carriacou

Eng. Rubi Despaigne Benitez proceeded with the surveys. Selwyn Woodroffe made himself available to review progress and answer questions. The field surveys were completed on 29 May 1998. Photographs were received on 18 August 1998.

2.3 Desk Studies

To assist with the determination of vulnerability to hurricanes (and in accordance with the ToR) the software package WIND-RITE was utilised. WIND-RITE is a software system developed by the Wind Engineering Research Center at Texas Tech University, Lubbock, TX in conjunction with the Insurance Institute for Property Loss Reduction. This program is used to establish a relative grade for the wind resistance of buildings by assigning various vulnerability weights to: site environment, roof envelope, wall envelope, structural framing, and other secondary considerations.

A relative grade between 1 and 10 is assigned to a building during the evaluation process. A relative grade of 1 indicates that the building is highly resistant to wind-induced damage (less damage), whereas a building which receives a relative grade of 10 is highly susceptible to wind-induced damage (extensive damage). For non-engineered construction, a score of five would be considered very satisfactory.

To assist with the determination of vulnerability to earthquakes (and in accordance with the ToR) the methodology of Ahmed F Hassan [8] was used. This methodology relies mainly on readily accessible data for an existing building such as the dimensions and arrangement of its structural elements and the floor area. Masonry walls, concrete columns and steel columns are given progressively higher weightings in determining their contributions to seismic resistance. The end result is a comparative assessment of seismic vulnerability. A copy of Hassan's is provided in Appendix II.

3 RESULTS

3.1 Vulnerability to Hurricanes

3.1.1 General Observations

It would not be unreasonable for the Government to require that its new, formally-designed, school buildings would have the capacity to be largely undamaged by a 50-year-return-period hurricane.

The objective stated above requires simply the application of known technology by the school's architects and engineers to:

- conceptual design (*ie* site selection, shape, materials, structural systems);
- analysis (*ie* mathematical determination of forces, stresses and deformations of the building elements); and
- detailing (*ie* the determination and presentation, principally through drawings, of all of the details of construction).

The next requirement is for faithful attention to be paid during construction to the details incorporated in the drawings, schedules and technical specifications for the project. Supervision and inspection are central to success in this area of execution.

The final requirement is for the property to be adequately maintained.

The above precepts seem simple enough. Yet schools are often damaged and indeed sometimes destroyed by hurricane events no worse than the "design" storm. That design storm cannot be less than (and could reasonably be greater than) the "50-year" storm. These failures come about because of the failure of the systems (or the inadequacy of the systems) set up to order the construction industry and to maintain public property.

3.1.2 Aspects of Vulnerability

The experience of recent hurricanes has demonstrated that most failures occur to roofs, windows and external doors. In a very few cases there is damage (or collapse) of walls. In even fewer cases there is foundation failure. The experience in Grenada provides confirmatory evidence of this pattern.

Roofs:

- Most of the schools have gable roofs of moderate pitch. A few have hipped ends to their roofs, and a few have mono-pitch roofs. Few of the roofs are optimally steep. Concrete roofs are favourable, so are hipped ends. Mono-pitch roofs are unfavourable and gable roofs are acceptable, provided special attention is paid to the gable-end fastening of lightweight roof sheets.
- It is well known that certain areas of roofs are much more highly stressed by wind forces than other parts. Nevertheless most of the roofs observed had constant spacing of fasteners throughout.
- The ridge fixings (without underlying spacer blocks) and the types of washers are in many cases unsatisfactory for confident resistance to wind uplift forces. Valley fixings, where they are used on sheets of trapezoidal profile, have shown themselves to be much more secure - everything else being equal.
- Lightweight roof sheeting has been used for most of the schools. This sheeting is of several profiles, several thicknesses and several types of material. The tendency, because of commercial pressures and budgetary constraints, is for the sheeting to be somewhat thinner than is desirable.

Windows (and other openings):

- If the wind can get in, then the rain can get in. If the rain can get in, it is surprising what else can get in. Also, if the rain can get in, the use of the building as a hurricane shelter is compromised.
- The convenience of aluminium and timber louvres for everyday use is self-evident. But it must be recognised that such windows have difficulty in keeping out torrential rain driven by strong winds. Decorative (or "breeze") blocks are practical and durable, however this type of opening is clearly vulnerable to the ingress of wind-driven rain.
- Flying debris usually accompanies hurricanes. Glass windows are very vulnerable to breakage if impacted by such debris. Other materials (aluminium and thin, wooden, louver blades) could also suffer damage in such circumstances.
- There was little evidence in the field surveys that the various properties were provided with "in-place" storm shutters or dedicated prefabricated shutters in secure storerooms. Without shutters most of the buildings would be unsatisfactory shelters during severe hurricanes.

External Doors:

- Doors are much less vulnerable than windows. Their materials of fabrication are usually more robust. The main aspects of vulnerability are the hinges, the locks and the absence of bolts at the tops and bottoms of the "free" edges.
- No braces were noticed for securing doors against wind forces.

3.1.3 Summary of Results

The table below summarises the conclusions of the survey with respect to wind vulnerability. A higher WIND-RITE Rating indicates a higher vulnerability to hurricane events.

Property	Individual Building and Code Number	Description	Vulnerable Areas	WIND-RITE Rating
St. David's R.C. School	SDRCS-01A	Two storey building providing approximately 4040 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Timber louvers • Metal sheeting connections • Breeze block windows 	8.26
	SDRCS-01B	Single storey building providing approximately 1550 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.26
	SDRCS-01C	Single storey building providing approximately 2120 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Timber louvers • Metal sheeting connections • Breeze block windows 	8.26
Pomme Rose R.C. School	PRRCS-02A	Two storey building providing approximately 6060 sq. ft. of shelter floor area. Constructed in 1974.	<ul style="list-style-type: none"> • Roof timber connections • Timber louvers • Metal sheeting connections • Breeze block windows 	8.03
	PRRCS-02B	Two storey building providing approximately 15,500 sq. ft. of shelter floor area. Constructed in 1974.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections 	8.03

Crochu R.C. School	PRRCS-02C	Single storey building providing approximately 7340 sq. ft. of shelter floor area. Constructed in 1974.	<ul style="list-style-type: none"> • Breeze block windows • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.03
	CRCS-03A	Single storey building providing approximately 2070 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03B	Single storey building providing approximately 4200 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03C	Single storey building providing approximately 3110 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03D	Single storey building providing approximately 5460 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03E	Single storey building providing approximately 1010sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	N/A

	CRCS-03F	Single storey building providing approximately 966 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03G	Single storey building providing approximately 1550 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03H	Single storey building providing approximately 4200 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03I	Single storey building providing approximately 4200 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
	CRCS-03J	Single storey building providing approximately 2100sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.43
St. Giles Anglican School	SGAS-04	Single storey building providing approximately 4535 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass windows • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.82
Holy Cross R.C.	HCRCS-05	Two storey building	<ul style="list-style-type: none"> • Roof timber 	9.12

School		providing approximately 16340 sq. ft. of shelter floor area. Constructed in 1972.	connections <ul style="list-style-type: none"> • Aluminium louvers • Metal sheeting connections • Breeze block windows 	
Belair Government School	BGS-06	Two storey building providing approximately 5650 sq. ft. of shelter floor area. Constructed in 1951.	<ul style="list-style-type: none"> • Roof timber connections • Metal sheeting connections 	9.38
Paraclete Government School	PGS-07A	Single storey building providing approximately 1210 sq. ft. of shelter floor area. Constructed in 1969.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.14
	PGS-07B	Single storey building providing approximately 4040 sq. ft. of shelter floor area. Constructed in 1969.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.14
	PGS-07C	Single storey building providing approximately 810 sq. ft. of shelter floor area. Constructed in 1969.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.14
	PGS-07D	Single storey building providing approximately 4775 sq. ft. of shelter floor area. Constructed in 1969.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.14
	PGS-07E	Single storey building providing approximately 1210 sq. ft. of shelter floor area. Constructed in 1969.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.14
	PGS-07F	Single storey building providing approximately 2020 sq. ft. of shelter floor area. Constructed in 1969.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.14
Calliste	CGS-08	Two storey building	<ul style="list-style-type: none"> • Roof timber 	8.88

Government School		providing approximately 5080 sq. ft. of shelter floor area. Constructed in 1974.	<ul style="list-style-type: none"> connections • Metal sheeting connections • Breeze block windows 	
Happy Hill Secondary School	HHSS-09A	Single storey building providing approximately 4026 sq. ft. of shelter floor area. Constructed in 1980.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.86
	HHSS-09B	Two storey building providing approximately 9935 sq. ft. of shelter floor area. Constructed in 1980.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.86
Beaulieu R.C. School	BRCS-10A	Two storey building providing approximately 4670 sq. ft. of shelter floor area. Constructed in 1980s.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.5
	BRCS-10B	Two storey building providing approximately 5640 sq. ft. of shelter floor area. Constructed in 1980s.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	8.5
St. Paul's Government School	SPGS-11A	Single storey building providing approximately 7460 sq. ft. of shelter floor area. Constructed in 1937.	<ul style="list-style-type: none"> • Roof timber connections • Metal sheeting connections • Breeze block windows 	9.4
	SPGS-11B	Single storey building providing approximately 525 sq. ft. of shelter floor area. Constructed in 1937.	<ul style="list-style-type: none"> • Roof timber connections • Metal sheeting connections • Breeze block windows 	9.4
	SPGS-11C	Single storey building providing approximately 650 sq. ft. of shelter floor area.	<ul style="list-style-type: none"> • Roof timber connections • Metal sheeting connections 	9.4

		Constructed in 1937.	<ul style="list-style-type: none"> • Breeze block windows 	
St. Louis R.C. School	SLRCS-12A	Two storey building providing approximately 2500sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Glass windows • Metal sheeting connections • Breeze block windows 	9.32
	SLRCS-12B	Single storey building providing approximately 940 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass windows • Glass louvers • Metal sheeting connections • Breeze block windows 	9.32
	SLRCS-12C	Single storey building providing approximately 2380 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.32
	SLRCS-12D	Single storey building providing approximately 1344 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Glass windows • Metal sheeting connections • Breeze block windows 	9.32
South St. George Government School	SGS-13	Two storey building providing approximately 11,300 sq. ft. of shelter floor area. Constructed in 1968.	<ul style="list-style-type: none"> • Metal sheeting connections • Breeze block windows 	8.63
Mt. Rose Comprehensive School	MRCS-14	Two storey building providing approximately 7270 sq. ft. of shelter floor area. Constructed in 1974.	<ul style="list-style-type: none"> • Roof timber connections • Aluminium louvers • Metal sheeting connections • Breeze block windows 	9.32
St. Patrick's Anglican School	SPAS-15	Two storey building providing approximately 7270 sq. ft. of shelter floor area.	<ul style="list-style-type: none"> • Roof timber connections • Glass windows • Metal sheeting 	9.32

		Constructed in 1962.	connections	
Loretto Government School	LGS-16A	Single storey building providing approximately 4063 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Metal sheeting connections 	9.56
	LGS-16B	Single storey building providing approximately 1170 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Metal sheeting connections 	9.56
	LGS-16C	Single storey building providing approximately 1170 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Glass louvers • Metal sheeting connections 	9.56
Concord Government School	CGS-17	Two storey building providing approximately 5690 sq. ft. of shelter floor area. Unknown construction date.	<ul style="list-style-type: none"> • Roof timber connections • Timber louvers • Metal sheeting connections • Breeze block windows 	8.69
St. Mark's Secondary School	SMSS-18A	Single storey building providing approximately 1414 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Mesh panels • Metal sheeting connections • Breeze block windows 	9.3
	SMSS-18B	Single storey building providing approximately 3117 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Mesh panels • Metal sheeting connections • Breeze block windows 	9.3
	SMSS-18C	Single storey building providing approximately 1414 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Mesh panels • Metal sheeting connections • Breeze block windows 	9.3
	SMSS-18D	Single storey building	<ul style="list-style-type: none"> • Glass louvers 	9.3

		providing approximately 1950 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> Aluminium louvers Mesh panels Metal sheeting connections Breeze block windows 	
	SMSS-18E	Single storey building providing approximately 2340 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> Glass louvers Aluminium louvers Mesh panels Metal sheeting connections Breeze block windows 	9.3
	SMSS-18F	Single storey building providing approximately 924 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> Glass louvers Aluminium louvers Mesh panels Metal sheeting connections Breeze block windows 	9.3
	SMSS-18G	Single storey building providing approximately 1170 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> Glass louvers Aluminium louvers Mesh panels Metal sheeting connections Breeze block windows 	9.3
	SMSS-18G	Single storey building providing approximately 1170 sq. ft. of shelter floor area. Constructed in 1971.	<ul style="list-style-type: none"> Glass louvers Aluminium louvers Mesh panels Metal sheeting connections Breeze block windows 	9.3
Dover Government School	DGS-19	Single storey building providing approximately 10,000 sq. ft. of shelter floor area. Constructed in 1932.	<ul style="list-style-type: none"> Roof timber connections Aluminium louvers Metal sheeting connections Breeze block windows 	9.54
Hillsborough Government School	HGS-20	Single storey building providing approximately 6400 sq. ft. of shelter floor area. Constructed in 1956.	<ul style="list-style-type: none"> Roof timber connections Aluminium louvers Metal sheeting connections Breeze block windows 	9.0

N/A indicates that a WIND-RITE result was not obtained due to insufficient survey information.

The WIND-RITE analysis results appear to indicate that the properties have an approximate equally high vulnerability to hurricanes. It should be noted that the WIND-RITE program will produce high vulnerabilities if the building has unprotected openings and light-weight sheeting. Since these vulnerable areas can be addressed relatively easily, it is not considered prudent to exclude a property from being considered as a shelter based on these results.

3.2 Vulnerability to Torrential Rain

3.2.1 General Observations

Property becomes vulnerable to torrential rain either directly, if the rain penetrates the building envelope, or indirectly, through the resultant flooding events. Improperly sealed window and door openings or roof covering can result in the immediate ingress of water, while poorly sited buildings, and/or buildings with inadequate or improperly maintained drainage systems can result in the property being vulnerable to flooding.

The not so immediate effect of flooding caused by torrential rains is the adverse effect it can have on a building's foundations.

Coastal areas can be particularly vulnerable to flooding especially if high tides accompany heavy rains. In addition, the groundwater level is generally higher in coastal areas resulting in less absorption by the ground and an increased incidence of flooding.

3.2.2 Summary of Results

The table below summarises the conclusions of the survey with respect to torrential rain vulnerability.

Property	Individual Building and Code Number	Location of Property	Vulnerable Areas
St. David's R.C. School	SDRCS-01A	<ul style="list-style-type: none"> Sloped topography Urban location Open field 	<ul style="list-style-type: none"> Aluminium louvers Breeze blocks
	SDRCS-01B	<ul style="list-style-type: none"> Sloped topography Urban location Open field 	<ul style="list-style-type: none"> Aluminium louvers Breeze blocks
	SDRCS-01C	<ul style="list-style-type: none"> Sloped topography Urban location Open field 	<ul style="list-style-type: none"> Aluminium louvers Breeze blocks
Pomme Rose R.C. School	PRRCS-02A	<ul style="list-style-type: none"> Relatively flat topography Open field Rural location 	<ul style="list-style-type: none"> Aluminium louvers Timber louvers Breeze blocks
	PRRCS-02B	<ul style="list-style-type: none"> Relatively flat topography Open field Rural location 	<ul style="list-style-type: none"> Aluminium louvers Timber louvers Breeze blocks

	PRRCS-02C	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Aluminium louvers • Timber louvers • Breeze blocks
Crochu R.C. School	CRCS-03A	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03B	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03C	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03D	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03E	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03F	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03G	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03H	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03I	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
	CRCS-03J	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers
St. Giles Anglican School	SGAS-04	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers
Holy Cross R.C. School	HCRCS-05	<ul style="list-style-type: none"> • Relatively flat topography • Open field • Rural location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
Belair Government School	BGS-06	<ul style="list-style-type: none"> • Sloping ground • Rural location • Open field 	<ul style="list-style-type: none"> • Timber louvers

Paraclete Government School	PCGS-07A	<ul style="list-style-type: none"> • Relatively flat topography • Rural location • Open field 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Breeze blocks
	PCGS-07B	<ul style="list-style-type: none"> • Relatively flat topography • Rural location • Open field 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Breeze blocks
	PCGS-07C	<ul style="list-style-type: none"> • Relatively flat topography • Rural location • Open field 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Breeze blocks
	PCGS-07D	<ul style="list-style-type: none"> • Relatively flat topography • Rural location • Open field 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Breeze blocks
	PCGS-07E	<ul style="list-style-type: none"> • Relatively flat topography • Rural location • Open field 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Breeze blocks
	PCGS-07F	<ul style="list-style-type: none"> • Relatively flat topography • Rural location • Open field 	<ul style="list-style-type: none"> • Glass louvers • Aluminium louvers • Breeze blocks
Calliste Government School	CGS-08	<ul style="list-style-type: none"> • Relatively flat topography • Coastal location 	<ul style="list-style-type: none"> • Breeze blocks
Happy Hill Secondary School	HHSS-09A	<ul style="list-style-type: none"> • Sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks
	HHSS-09B	<ul style="list-style-type: none"> • Sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks
Beaulieu R.C. School	BRCS-10A	<ul style="list-style-type: none"> • Sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks
	BRCS-10B	<ul style="list-style-type: none"> • Sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks
St. Paul's Government School	SPGS-11A	<ul style="list-style-type: none"> • Sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers
	SPGS-11B	<ul style="list-style-type: none"> • Sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers
	SPGS-11C	<ul style="list-style-type: none"> • Sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers
St. Louis R.C. School	SLRCS-12	<ul style="list-style-type: none"> • Hilly terrain • Residential location 	<ul style="list-style-type: none"> • Glass windows • Timber louvers
South St. George Government School	SGS-13	<ul style="list-style-type: none"> • Gently sloping topography • Residential location 	<ul style="list-style-type: none"> • Breeze blocks
Mt. Rose Comprehensive School	MRCS-14	<ul style="list-style-type: none"> • Relatively flat topography • Rural location 	<ul style="list-style-type: none"> • Aluminium louvers
St. Patrick's	SPAS-15A	<ul style="list-style-type: none"> • Gently sloping ground 	<ul style="list-style-type: none"> • Glass windows

Anglican School		<ul style="list-style-type: none"> • Rural /residential location 	<ul style="list-style-type: none"> • Breeze blocks
	SPAS-15B	<ul style="list-style-type: none"> • Gently sloping ground • Rural /residential location 	<ul style="list-style-type: none"> • Glass windows • Breeze blocks
Loretto Government School	LGS-16A	<ul style="list-style-type: none"> • Sloping ground • Rural location • Open field 	<ul style="list-style-type: none"> • Glass windows • Glass louvers
	LGS-16B	<ul style="list-style-type: none"> • Sloping ground • Rural location • Open field 	<ul style="list-style-type: none"> • Glass windows • Glass louvers
	LGS-16C	<ul style="list-style-type: none"> • Sloping ground • Rural location • Open field 	<ul style="list-style-type: none"> • Glass windows • Glass louvers
Concord Government School	CGS-17	<ul style="list-style-type: none"> • Sloping ground • Open field • Rural location 	<ul style="list-style-type: none"> • Breeze blocks • Glass windows
St. Mark's Secondary School	SMSS-18A	<ul style="list-style-type: none"> • Gently sloping • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
	SMSS-18B	<ul style="list-style-type: none"> • Gently sloping • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
	SMSS-18C	<ul style="list-style-type: none"> • Gently sloping • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
	SMSS-18D	<ul style="list-style-type: none"> • Gently sloping • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
	SMSS-18E	<ul style="list-style-type: none"> • Gently sloping • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
	SMSS-18F	<ul style="list-style-type: none"> • Gently sloping • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
	SMSS-18G	<ul style="list-style-type: none"> • Gently sloping • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Timber louvers • Aluminium louvers
Dover Government School	DGS-19	<ul style="list-style-type: none"> • Flat ground • Coastal/residential location 	<ul style="list-style-type: none"> • Breeze blocks • Floor (flooding)
Hillsborough Government School	HGS-20	<ul style="list-style-type: none"> • Flat ground • Coastal location 	<ul style="list-style-type: none"> • Breeze blocks • Floor (flooding)

3.3 Vulnerability to Earthquakes

3.3.1 Multi-hazard Design

When compared with dealing with a single hazard, designing against multiple hazards is more than doubly difficult, especially when those hazards are wind and earthquake. Some favourable features of wind-resistant design are unfavourable for earthquake-resistant design and *vice versa*, e.g. :

- Heavy structures resist winds better. Light structures resist earthquakes better.
- Flexible structures attract greater wind forces. Stiff structures (generally) attract greater earthquake forces.

Both hurricanes and earthquakes impose horizontal loads on buildings. Earthquakes also impose significant vertical loads on the overall building. The vertical loading derived from wind is usually significant on parts of a building as determined by aerodynamic considerations.

However, there are many similarities in the effective design and construction of buildings to resist hurricanes and earthquakes:

- Symmetrical shapes are favourable.
- Compact shapes are favourable.
- There must be a realisation that there is a real risk that "design" forces may be exceeded. This is particularly so in the case of earthquakes where the design force is deliberately determined to be less than that expected during the anticipated life of the building. This leads to a requirement for redundancy in the structure and for "toughness" - the ability to absorb overloads without collapse.

Connections are of paramount importance. Each critical element must be firmly connected to the adjacent elements.

3.3.2 Differences Between Designing Against Earthquakes and Hurricanes

There is a basic difference in the performance expectations in the event of an earthquake as opposed to a hurricane. A building is expected to survive its "design hurricane" with virtually no damage. Even a catastrophic hurricane should only lead to repairable damage. On the other hand the "design earthquake" is expected to cause (hopefully repairable) damage, and a catastrophic earthquake is likely to lead to a situation where the building cannot be repaired and must be demolished. In such an event success is measured by the absence of deaths and serious injuries.

3.3.3 Aspects of Vulnerability

Designing schools to be safe during earthquakes is a complex process requiring the involvement of specialist structural engineers. In Grenada, as in most parts of the Caribbean, the problem is compounded because of the absence, until very recently, of mandatory earthquake-resistant standards and the lack of a tradition of conscious engineering attention to this subject. Indeed there is no consensus that the hazard is sufficiently serious to warrant concerted action. Thus successes in the area of earthquake-resistant construction tend to be accidental. This comes about principally when the dominant design criterion overrides the demands of earthquake-resistant design.

The main problem areas are summarised below.

- Structural vulnerability was noted mainly in two-storey construction and in masonry walls where the presence of reinforcement was moot. (Since concrete block walls often collapse during seismic shaking, all concrete block walls should be reinforced and tied to the adjacent structures.)
- Internal lighting fixtures and utility equipment were generally not fastened to structural elements securely enough to withstand large ground accelerations.
- Closets and heavy furniture were generally not fastened or strapped to the walls where these constituted a danger or contained valuable property.

3.3.4 Summary of Results

The table below summarises the conclusions of the survey with respect to earthquake vulnerability. A higher Seismic Relative Vulnerability Number indicates a lower vulnerability to seismic events.

Property	Individual Building and Code Number	Structural Description	Seismic Relative Vulnerability Number
St. David's R.C. School	SDRCS-01A	R.C. frame, 8" thick masonry wall, lightweight roof. Two story building.	0.82
	SDRCS-01B	R.C. frame, 8" thick masonry Single story building.	4.9
	SDRCS-01C	R.C. frame, 8" thick masonry wall, lightweight roof. Single story building.	2.72
Pomme Rose R.C. School	PRRCS-02A	R.C. frame, 8" thick masonry wall, lightweight roof. Two story building.	0.34
	PRRCS-02B	R.C. frame, 8" thick masonry wall, lightweight roof. Two story building.	0.34
	PRRCS-02C	R.C. frame, 8" thick masonry wall, lightweight roof. Single story building.	5.9
Crochu R.C. School	CRCS-03A	Single storey steel framed building, light weight roof.	0.28
	CRCS-03B	Single story steel framed building, light weight roof.	0.38
	CRCS-03C	Single story steel framed building, light weight roof.	0.33
	CRCS-03D	Single story steel framed building, light weight roof.	0.31
	CRCS-03E	Single story steel framed building, light weight roof.	0.42
	CRCS-03F	Single storey steel framed building, light weight roof.	0.37

	CRCS-03G	Single story steel framed building, light weight roof.	0.35
	CRCS-03H	Single story steel framed building, light weight roof.	0.32
	CRCS-03I	Single storey steel framed building, light weight roof.	0.35
	CRCS-03J	Single story steel framed building, light weight roof.	0.32
St. Giles Anglican School	SGAS-04	R.C. frame, 8" masonry walls, light weight roof. Single story building	3.70
Holy Cross R.C. School	HCRCS-05	R.C. frame, 8" masonry walls, light weight roof. Two story building.	0.16
Belair Government School	BGS-06	R.C. Frame, 8" masonry wall, light weight roof. Two story building.	0.13
Paraclete Government School	PCGS-07A	Single story steel framed building, light weight roof.	0.35
	PGS-07B	Single story steel framed building, light weight roof.	0.91
	PGS-07C	Single story steel framed building, light weight roof.	0.28
	PGS-07D	Single story steel framed building, light weight roof.	0.15
	PGS-07E	Single story steel framed building, light weight roof.	0.91
	PGS-07F	Single story steel framed building, light weight roof.	0.59
Calliste Government School	CGS-08	R.C. frame, 8" thick masonry wall, lightweight roof. Two story building.	0.20
Happy Hill Secondary School	HHSS-09A	R.C. frame, 8" thick masonry Single story building.	0.26
	HHSS-09B	R.C. frame, 8" thick masonry wall, lightweight roof. Two story building.	0.17
Beaulieu R.C. School	BRCS-10A	R.C. frame, 8" thick masonry wall, lightweight roof. Two story building.	0.57
	BRCS-10B	R.C. frame, 8" thick masonry Single story building.	0.39
St. Paul's Government School	SPGS-11A	One story masonry building.	N/A
	SPGS-11B	One story masonry building.	N/A
	SPGS-11C	One story masonry building.	N/A
St. Louis R.C. School	SLRCS-12	R.C. frame, 8" masonry, walls.	0.91
South St. George Government School	SGS-13	R.C. frame, 8" thick masonry Single story building.	1.98

Mt. Rose Comprehensive School	MRCS-14	R.C. frame, 8" thick masonry Single story building.	0.62
St. Patrick's Anglican School	SPAS-15A	R.C. frame, 8" thick masonry. Two story building.	0.63
	SPAS-15B	R.C. frame, 8" thick masonry. Two story building.	N/A
Loretto Government School	LGS-16A		N/A
	LGS-16B		N/A
	LGS-16C		N/A
Concord Government School	CGS-17	R.C. frame, 8" thick masonry Single story building.	0.46
St. Mark's Secondary School	SMSS-18A	Single story steel framed building, light weight roof.	0.31
	SMSS-18B	Single story steel framed building, light weight roof.	0.53
	SMSS-18C	Single story steel framed building, light weight roof.	0.41
	SMSS-18D	Single story steel framed building, light weight roof.	0.33
	SMSS-18E	Single story steel framed building, light weight roof.	0.37
	SMSS-18F	Single story steel framed building, light weight roof.	0.43
	SMSS-18G	Single story steel framed building, light weight roof.	0.42
Dover Government School	DGS-19A	Single story masonry structure.	0.41
	DGS-19B	Single story masonry structure.	4.36
Hillsborough Government School	HGS-20A	Single story masonry structure.	4.48

The buildings given a grade of N/A are buildings for there was insufficient information.
R.C. = Reinforced Concrete

4 GENERAL ISSUES

4.1 Impact of Hurricanes on Caribbean Schools

Hurricanes David in 1979, Allen in 1980, Hugo in 1989 and Luis in 1995 caused significant damage to schools in Dominica, St. Lucia, Montserrat and Antigua respectively. The review of the damage to most of the schools showed that roof failure was the primary cause of problems, leading in some cases to complete collapse of the walls. Most of the roofs were made of wooden rafters or trusses with 26-gauge (or thinner) galvanised sheeting. Few roofs of aluminium sheeting survived. Some roofs remained partially intact but the damage to windows, doors and internal partitions was significant. Some wooden structures were

completely destroyed, sometimes by falling trees and sometimes by being blown off their foundations.

In Grenada, in 1955 Hurricane Janet caused wide spread destruction of property and much loss of life. Again the major damage to the building stock was triggered by initial loss of roofs. Since minor damage caused by Hurricane Flora in 1963, Grenada has experienced relatively calm hurricane seasons. This has led to much complacency among property owners and Grenadians paid heavily for this in 1990 when Tropical Storm Arthur (with winds reportedly not exceeding 50 mph) played havoc with the building stock in Grenada. Several roofs of school buildings were damaged.

In general, therefore, the response of the school buildings to hurricane forces must be judged to have been poor. It is disturbing to note that the reconstruction of many of the schools which suffered from the recent hurricanes and the construction of some new schools have been based on the same design concepts which have led to the failures.

4.2 Hazards versus Disasters

Disasters are often seen as unpredictable, having to do with luck and part of the risks of everyday living. Surely we have progressed beyond the stage when superstition, mythology and fatalism were the public responses to natural hazards. Hurricanes are not natural disasters, they are natural events which sometimes lead to manmade disasters. In these days of widespread technological education, sophisticated research, reliable building materials, computer-based geographical information systems and satellite-assisted warning programmes, hurricanes in the Caribbean should not lead to disasters. The one exception to this would be vulnerable agricultural crops such as bananas.

It is now evident that disasters due to natural hazards are largely preventable and soon the public will demand deliberate actions to protect communities against hazardous events.

4.3 Codes and Standards

The development and maintenance of building standards and codes is a continuing process in many countries. The mandate of national or regional professional and governmental institutions usually includes the development of building standards and the co-ordination of such activities among its various constituent members.

To date the majority of countries in the Caribbean region are without satisfactory, mandatory standards dealing adequately with any of the prevalent natural hazards. In Grenada, attempts are currently being made to adapt the existing (but unenforced) OECS Building Code in much the same way that Antigua and Dominica have done. The intention is to produce a Grenada Building Code and Building Guidelines and have it passed into law. When this has been done, the Land Development and Control Authority will need to be given firm authority to require all developments to be designed and constructed in accordance with the Building Code and Building Guidelines.

4.4 The Regulatory Environment

Some government agencies adopt an *ad hoc* approach to standards based, principally, on the particular individuals involved in the specific projects. In most cases the administrators tacitly assume that their designers and builders would do what is right without being told. In other cases the administrators adopt the approach of not objecting to safe design and construction, provided that these attributes do not interfere with their other aims for the projects.

Many government capital works projects are funded by international lending agencies. Typically there is

reluctance on the part of these agencies to impose structural design criteria on their projects. The funding agencies leave it up to the governments and the governments leave it up to their designers and builders. This *laissez-faire* approach leads to inconsistent performance, lack of reliability and, arguably, to higher overall life-cycle costs for the built environment.

The adoption and enforcement of an approved building code is now the critical function to be performed. The system of check consultants (*bureaux de contrôle*), routinely used in French territories, is proposed. Check consultants are independent of the design consultants. It is well recognised that quality assurance is more effective where checking is done independently of creating. The system mentioned above formalises the process.

4.5 Public Awareness

During the past 111 years a total of approximately 1000 tropical storms and hurricanes have been recorded over the North Atlantic area. Of these, about 50 percent were hurricanes, many in the general area of the Caribbean. With such a record, it is not surprising that everyone in this region accepts that hurricanes are a fact of life. However, the frequency of direct hits by hurricanes on any one territory is low. This has led to a considerable lack of consciousness amongst Caribbean people as to the dangerous risk to their own properties. Few believe that their island would be hit.

In the post-Columbian history of Grenada there have been 29 recorded tropical cyclone events that have affected the island. Not all of these were direct hits by hurricane-force winds. In many cases the effects were by way of heavy seas and torrential rain. The most recent of these events was Hurricane Janet in 1955. In 1990 Tropical storm Arthur caused significant damage in Grenada.

4.6 Vulnerability Surveys

4.6.1 Qualitative Assessment

This is the level of assessment being carried out in the present programme. This level of evaluation does not envisage exhaustive testing of materials in place nor sophisticated computation of stresses. It does involve a careful review of all readily available data (such as drawings), an inspection of the building without destructive testing and a non-mathematical review of the data.

4.6.2 Analytical Evaluation

Facilities whose performances are deemed to be doubtful when assessed qualitatively would be subjected to an analytical evaluation. This procedure would also be used as a second stage, prior to implementation of retrofitting, in cases deemed to be self-evidently inadequate by qualitative assessment. Since analytical evaluation is a time-consuming and expensive exercise it would be appropriate to carry it out only when the funds were available for implementing the possible actions indicated by such evaluation.

It is envisaged that analytical evaluations will be undertaken for those schools selected for the CDB retrofit project.

4.7 Disaster Mitigation after the Event

In the aftermath of a disaster the focus is understandably on getting educational facilities to function again as soon as possible. Also, technical personnel and financial resources are spread very thin at such times. This combination of factors often leads to repairs being carried out in an expedient manner without adequate attention to safety issues. Indeed, post-disaster repairs often leave the buildings even more

vulnerable than they were in their pre-disaster, inadequate states.

If such a scenario is to be avoided, the custodians of the educational facilities must take very deliberate steps. Such actions would include:

- clear instructions (on performance criteria for natural hazards) given to engineers, architects and contractors involved in repairs and rehabilitation;
- a willingness to accept (temporarily) smaller functioning spaces or fewer classrooms if the repair funding is inadequate to achieve safe standards for all of the damaged facilities; and
- the employment of a mitigation officer to review and monitor the designs and construction so as to ensure that the agreed performance criteria are being met.

4.8 Maintenance as a Tool for Mitigation

The physical condition of many Caribbean schools is poor. Windows and doors show lack of maintenance and repair. It is considered that a major effort should be taken to bring the condition of the buildings to the standard where a normal maintenance crew can be expected to deal with the routine maintenance requirements of the facility. It is considered, also, that the existing staff and maintenance budget are generally insufficient to provide for proper maintenance.

It is recommended that for public buildings with the heavy use of a school, the annual maintenance budget should amount to about 4% of the contemporary capital cost of the building and equipment, assuming that the facilities are in good condition to start with. For schools, it is estimated that the replacement cost is about US\$150,000 per classroom. (This figure includes amounts for common and administrative areas as well as infrastructure.) The maintenance allocation should therefore be no less than US\$6,000 per classroom per year.

The maintenance of a school, rather than being a one-time activity as is the construction of the school, is a continuous daily operation of the institution and is an important ingredient in the delivery of education.

A good maintenance system is also a good disaster mitigation system, as the review of damage caused by recent hurricanes and floods has shown. To some extent the damage to buildings was due to lack of sustained maintenance of critical items. Also, a well operated system of maintenance for buildings and equipment has the effect of being a very effective disaster mitigation measure in terms of cost and facility usage. It ensures the most economic way to keep the building and equipment in the best of form for normal use, given the original design and materials. It is essential that a maintenance plan be included in disaster mitigation plans.

It should be noted that the establishment of a secure and orderly system of archiving of construction drawings depicting the as-built condition of the final structure is an essential ingredient of the long-term maintenance schedule of any constructed facility. Because the archive will serve its purpose over the lifetime of the facility, the protection of its contents against the effects of time cannot be overlooked.

5 SUMMARY

5.1 Recommendations

The following recommendations are made with a view to reducing the vulnerability of the buildings surveyed to hurricanes, torrential rains, and earthquakes. The activities required are generally:

1. Protect glass windows and doors with approved shutters.
2. Stop the rainwater ingress through breeze block windows by installing shutters.
3. Secure the timber shutters at the corners by installing bolts.
4. Improve timber roof framing connections by installing approved hurricane straps and ties.
5. Improve the roof sheeting connections by installing additional screws in vulnerable roof areas.
6. Improve the water tightness of the aluminium louver windows.
7. Strengthen un-reinforced masonry walls.
8. Improve the drainage around the property.

If these recommendations are carried out, most of the properties surveyed can be used as shelters.

The following table summarises the recommendations for each property.

Property	Individual Building and Code Number	Recommendations
St. David's R.C. School	SDRCS-01A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks. • Provide shutters to cover glass louvers where they exist. • Secure timber shutters.
	SDRCS-01B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks. • Provide shutters to cover glass louvers where they exist. • Secure timber shutters.
	SDRCS-01C	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks. • Provide shutters to cover glass louvers where they exist. • Secure timber shutters.
Pomme Rose R.C. School	PRRCS-02A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover louvers.
	PRRCS-02B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover louvers.
	PRRCS-02C	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover louvers.

Crochu R.C. School	CRCS-03A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	CRCS-03B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	CRCS-03C	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	CRCS-03D	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	CRCS-03E	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	CRCS-03F	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Protect glass windows. • Improve water tightness of aluminium louvers.
	CRCS-03G	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	CRCS-03H	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	CRCS-03I	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Install shutters over open windows. • Secure timber shutters.
	CRCS-03J	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas.

		<ul style="list-style-type: none"> • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
St. Giles Anglican School	SGAS-04	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Protect glass windows. • Provide timber shutters to cover breeze blocks. • Secure timber shutters.
Holy Cross R.C. School	HCRCS-05	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Improve water tightness of aluminium louvers. • Provide shutters to cover breeze blocks.
Belair Government School	BGS-06	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Secure timber shutters.
Paraclete Government School	PGS-07A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Improve water tightness of aluminium louvers. • Secure timber shutters.
	PGS-07B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	PGS-07C	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	PGS-07D	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	PGS-07E	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows. • Secure timber shutters.
	PCGS-07F	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve steel roof framing connections. • Protect glass windows.

		<ul style="list-style-type: none"> • Secure timber shutters.
Calliste Government School	CGS-08	<ul style="list-style-type: none"> • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks.
Happy Hill Secondary School	HHSS-09A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks. • Improve water tightness of aluminium louvers.
	HHSS-09B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks. • Improve water tightness of aluminium louvers.
Beaulieu R.C. School	BRCS-10A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks.
	BRCS-10B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks.
St. Paul's Government School	SPGS-11A	<ul style="list-style-type: none"> • Improve site drainage. • Provide shutters to cover the breeze blocks.
	SPGS-11B	<ul style="list-style-type: none"> • Improve site drainage. • Provide shutters to cover the breeze blocks.
	SPGS-11C	<ul style="list-style-type: none"> • Improve site drainage. • Provide shutters to cover the breeze blocks.
St. Louis R.C. School	SLRCS-12	<ul style="list-style-type: none"> • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks. • Protect glass windows.
South St. George Government School	SGS-13	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Provide shutters to cover the breeze blocks.
Mt. Rose Comprehensive School	MRCS-14	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Improve water tightness of aluminium louvers.
St. Patrick's Anglican School	SPAS-15A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Protect glass windows.
	SPAS-15B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections.

		<ul style="list-style-type: none"> • Protect glass windows.
Loretto Government School	LGS-16A	<ul style="list-style-type: none"> • Improve site drainage. • Protect glass windows.
	LGS-16B	<ul style="list-style-type: none"> • Improve site drainage. • Protect glass windows.
	LGS-16C	<ul style="list-style-type: none"> • Improve site drainage. • Protect glass windows.
Concord Government School	CGS-17	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Improve timber roof framing connections. • Provide shutters to cover the breeze blocks. • Secure timber shutters.
St. Mark's Secondary School	SMSS-18A	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Provide shutters to cover the breeze blocks. • Protect glass windows. • Improve water tightness of aluminium louvers. • Secure timber shutters.
	SMSS-18B	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Provide shutters to cover the breeze blocks. • Protect glass windows. • Improve water tightness of aluminium louvers. • Secure timber shutters.
	SMSS-18C	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Provide shutters to cover the breeze blocks. • Protect glass windows. • Improve water tightness of aluminium louvers. • Secure timber shutters.
	SMSS-18D	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Provide shutters to cover the breeze blocks. • Protect glass windows. • Improve water tightness of aluminium louvers. • Secure timber shutters.
	SMSS-18E	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Provide shutters to cover the breeze blocks. • Protect glass windows. • Improve water tightness of aluminium louvers. • Secure timber shutters.
	SMSS-18F	<ul style="list-style-type: none"> • Improve site drainage. • Install additional screws in vulnerable roof areas. • Provide shutters to cover the breeze blocks. • Protect glass windows. • Improve water tightness of aluminium louvers.

		<ul style="list-style-type: none"> Secure timber shutters.
	SMSS-18G	<ul style="list-style-type: none"> Improve site drainage. Install additional screws in vulnerable roof areas. Provide shutters to cover the breeze blocks. Protect glass windows. Improve water tightness of aluminium louvers. Secure timber shutters.
Dover Government School	DGS-19	<ul style="list-style-type: none"> Improve site drainage. Install additional screws in vulnerable roof areas. Improve timber roof framing connections. Provide shutters to cover the breeze blocks. Protect glass windows. Improve water tightness of aluminium louvers. Secure timber shutters.
Hillsborough Government School	HGS-20	<ul style="list-style-type: none"> Improve site drainage. Install additional screws in vulnerable roof areas. Improve timber roof framing connections. Provide shutters to cover the breeze blocks. Protect glass windows. Improve water tightness of aluminium louvers. Secure timber shutters.

5.2 Classes of Vulnerability

From the mitigating measures described in Section 5.1, several classes of vulnerability can be identified. They are:

1. Vulnerable roof
2. Vulnerable walls
3. Vulnerable dominant openings
4. Vulnerable site drainage

The following table identifies the vulnerable classes for each property.

Property	Individual Building and Code Number	Vulnerable Roof	Vulnerable Walls	Vulnerable Openings	Vulnerable Drainage
St. David's R.C. School	SDRCS-01A	a		a	a
	SDRCS-01B	a		a	a
	SDRCS-01C	a		a	a
Pomme Rose R.C. School	PRRCS-02A	a		a	a
	PRRCS-02B	a		a	a
	PRRCS-02C	a		a	
Crochu R.C. School	CRCS-01A	a		a	a
	CRCS-03B	a		a	a
	CRCS-03C	a		a	a

	CRCS-03D	a		a	a
	CRCS-03E	a		a	a
	CRCS-03F	a		a	a
	CRCS-03G	a		a	a
	CRCS-03H	a		a	a
	CRCS-03I	a		a	a
	CRCS-03J	a		a	a
St. Giles Anglican School	SGAS-04	a		a	a
Holy Cross R.C. School	HCRCS-05	a		a	a
Belair Govt School	BGS-06	a	a	a	a
Paraclete Govt School	PGS-07A	a		a	a
	PGS-07B	a		a	a
	PGS-07C	a		a	a
	PGS-07D	a		a	a
	PGS-07E	a		a	a
	PGS-07F	a		a	a
Calliste Govt School	CGS-08	a		a	a
Happy Hill Secondary School	HHSS-09A	a		a	a
	HHSS-09B	a		a	a
Beaulieu R.C. School	BRCS-10A	a		a	a
	BRCS-10B	a	a	a	a
St. Paul's Govt School	SPGS-11A	a		a	a
	SPGS-11B	a		a	a
	SPGS-11C	a		a	a
St. Louis R.C. School	SLRCS-12	a		a	a
South St. George Govt School	SGS-13	a		a	a
Mt. Rose Comprehensive School	MRCS-14	a		a	a
St. Patrick's Anglican School	SPAS-15A	a		a	a
	SPAS-15B	a		a	a
Loretto Government School	LGS-16A	a		a	a
	LGS-16B	a		a	a
	LGS-16C	a			a
Concord Government School	CGS-17	a		a	a
St. Mark's Secondary School	SMSS-18A	a		a	a
	SMSS-18B	a			a
	SMSS-18C	a		a	a
	SMSS-18D	a		a	a

	SMSS-18E	a			a
	SMSS-18F	a		a	a
	SMSS-18G	a		a	a
Dover Government School	DGS-19	a		a	a
Hillsborough Govt School	HGS-20A	a		a	a

5.3 Further Work

The intent of this report is to classify the surveyed properties with respect to their vulnerable areas, and hence retrofit needs. This has been done. The next step is to provide global cost estimates for performing the retrofit tasks. This will be done in a subsequent report.

REFERENCES

1. Caribbean Disaster Mitigation Project funded by the United States Agency for International Development (USAID) and managed by the OAS
2. European Community Humanitarian Office
3. Insurance Institute for Property Loss Reduction
4. International Development Research Centre, Ottawa, Canada
5. 1000 gals is approximately equal to the acceleration due to gravity.
6. kPa = kilopascals
7. metres per second
8. Seismic Vulnerability Assessment of Low-Rise Buildings in Regions with Infrequent Earthquakes by Ahmed F Hassan and Mete A Sozen, ACI Structural Journal, January-February 1997, pages 31 *et seq*

Hurricane Vulnerability Assessment

FIELD SURVEY GUIDE

Building Data

1. Name of Facility
2. Address
3. ID Number
4. Surveyor's Name
5. Survey Date
6. Year Constructed
7. Years of Major Additions or Changes
8. Was building formally engineered?
 - Yes
 - No
 - Do not know
9. Number of Storeys
10. Windstorm Loss History (Add separate sheet for additional details if necessary)
11. Surveyor's Comments (Add separate sheet for additional details if necessary)

Environment

1. Is there potential of debris from metal or wooden buildings, trees, loose material or roofing within 300 ft radius?
 - Yes
 - No
2. What is the type of surrounding terrain?
 - Coastal
 - Open field
 - Town
3. What is the type of topography?
 - Flat or gently undulating
 - Hillside or ridge
 - Promontory or cliff

Roof Envelope

1. Indicate the geometry of the roof:
 - Flat
 - Gable
 - Hip
 - Other (describe)
2. What is the primary roof support system (supported at the exterior walls)?
 - Reinforced concrete
 - Steel beam
 - Steel truss
 - Open-web steel joist
 - Tapered steel beam
 - Wood truss
 - Wood beam or rafter
 - Other (describe)
3. Is there a positive anchorage system (such as hurricane straps) connecting the roof system at the exterior walls?
 - Yes
 - No
 - Do not know
4. What materials are used for the roof deck?
 - Cast-in-place concrete slab
 - Precast concrete
 - Metal deck
 - Wood battens
 - Plywood
 - Wood close boarding
 - Other (describe)
5. What type of roof covering is used?
 - Built-up roof with gravel
 - Standing seam metal roof
 - Metal profiled sheets
 - Asbestos cement sheets
 - Single-ply membrane
 - Tile roof
 - Timber shingles
 - Asphalt shingles
 - Other (describe)
6. What is the age of the roof covering?
 - Less than 5 years
 - 5 to 10 years

- 11 to 15 years
- 16 to 20 years
- greater than 20 years
- Do not know

7. Are there skylights or ventilators on the roof?

- Yes
- No

Wall Envelope

1. What is the primary vertical load resisting system at the exterior walls?

- Reinforced concrete
- Steel
- Reinforced masonry
- Unreinforced masonry
- Wood
- Other (describe)

2. What is the percentage of wall area covered by glass or mesh or open blocks?

- 0% to 5%
- 6% to 20%
- 21% to 60%
- Greater than 60%

4. Are the glass or mesh or open blocks provided with permanently installed shutters?

- Yes
- No

4. Indicate the type of cladding (other than in 2 and 3 above) used

- Reinforced concrete block masonry
- Unreinforced concrete block masonry
- Precast concrete elements
- Stone panels
- Metal panels
- Wood
- Other (describe)

6. Indicate the type of external doors in the building

- Metal panels
- Solid wood (incl T&G)
- Hollow-core plywood
- Solid-core plywood
- Other (describe)

Other Considerations

1. Are there awnings, canopies, covered walkways or carports?
 - Yes
 - No
2. What wind code was used for the design of the building?
 - BNS CP28 - Code of Practice for Wind Loads for Structural Design
 - CUBiC Part 2 Section 2 - Structural Design Requirements, Wind Loads
 - BS 6399 Part 2 - Code of Practice for Wind Loads. Year?
 - ASCE 7 - Minimum Design Loads for Buildings and Other Structures. Year?
 - South Florida Building Code. Year?
3. What damage was suffered by the buildings due to Hurricanes Luis and Marilyn in 1995? (Add separate sheet for additional details if necessary)
4. What types of repairs or types of reconstruction have taken place? (Add separate sheet for additional details if necessary)
5. What standards (with reference to wind and earthquakes) were used in the repairs or reconstruction? (Add separate sheet for additional details if necessary)
6. Surveyor's comments (Add separate sheet for additional details if necessary)

Seismic Vulnerability Assessment

FIELD SURVEY GUIDE - PART 1

Name of Facility:

ID Number:

Member Information:

Member	Plan dimensions	Concrete block strength	Concrete strength	Reinforcement grade & %	Structural steel grade	Timber grade	Comments
Main foundations							
Columns							
Walls							
Beams							
Slabs							
Rafters							
Purlins							
Roofing							

Photographs:

- North elevation
- East elevation
- South elevation
- West elevation

Structural Systems (longitudinal)

- Load-bearing walls
- Braced frames
- Column and beam
- Mixed systems (describe)
- Soft storeys
- Short columns

Structural Systems (transverse)

- Load-bearing walls
- Braced frames
- Column and beam
- Mixed systems (describe)
- Soft storeys
- Short columns

School	ID number	Direction	Number of storeys	Total floor area	Column area at base (above grade)	RC wall area at base (steel columns)	Masonry wall length at base
		T _____ L					
		T _____ L					
		T _____ L					
		T _____ L					
		T _____ L					

Seismic Vulnerability Assessment**Field Survey Guide—Part 2**

School

ID Number

Column dimensions													
		1T	1L	2T	2L	3T	3L	4T	4L	5T	5L	6T	6L
A	3rd storey												
	2nd storey												
	1st storey												
B	3rd storey												
	2nd storey												
	1st storey												
C	3rd storey												
	2nd storey												
	1st storey												
D	3rd storey												
	2nd storey												
	1st storey												

Wall dimensions - Longitudinal

		1-2	1-2	2-3	2-3	3-4	3-4	4-5	4-5	5-6	5-6	6-7	6-7
		length	thickness	length	thickness	length	thickness	length	thickness	length	thickness	length	thick
A	3rd storey												
	2nd storey												
	1st storey												
B	3rd storey												

	2nd storey												
	1st storey												
C	3rd storey												
	2nd storey												
	1st storey												
D	3rd storey												
	2nd storey												
	1st storey												

Wall dimensions - Transverse

		1	1	2	2	3	3	4	4	5	5	6	6
		length	thickness	length	thickness	length	thickness	length	thickness	length	thickness	length	thick
A-B	3rd storey												
	2nd storey												
	1st storey												
B-C	3rd storey												
	2nd storey												
	1st storey												
C-D	3rd storey												
	2nd storey												
	1st storey												
D-E	3rd storey												
	2nd storey												
	1st storey												

Sketch

Line sketches should be provided at each floor level indicating:

- Columns
- Reinforced concrete (RC) walls and
- masonry walls.

Steel columns should be noted on the sketches and their overall dimensions stated in the table. In general, the walls should be shown only when they are continuous from floor to floor.

Seismic Vulnerability Assessment of Low-Rise Buildings in Regions with Infrequent Earthquakes

By Ahmed F. Hassan and Mete A. Sozen

Excerpt from the ACI Structural Journal. For a copy of the article in its entirety, see ACI Journal, V. 94, No. 1, January – February 1997.



This paper presents a simplified method of ranking reinforced concrete, low-rise, monolithic buildings according to their vulnerability to seismic damage. The ranking process requires only the dimensions of the structure. The process is tested using a group of buildings that suffered various levels of damage during the Erzincan earthquake of 1992. The ranking procedure reflected the observed damage satisfactorily.

Keywords: *buildings; earthquake-resistant structures; earthquakes; evaluation; failure; inspection; reinforced concrete; school buildings. .*

INTRODUCTION

The goal of conventional methods for evaluation of seismic vulnerability is to select buildings with a high probability of survival. This paper contains an alternative approach. A simple method is presented to help identify buildings with a high probability of severe damage.

In regions of frequent earthquake occurrence, it is proper and feasible to calibrate seismic safety assessment procedures conservatively in deference to extreme cases of damaged structures. Contradictions posed by buildings that survive earthquakes even though they would be rated hazardous by a ranking procedure calibrated exclusively on damaged structures are often ignored. As long as the number of buildings classified as hazardous is not overwhelming, this "upper-bound approach" does not stop the development of a policy for earthquake risk reduction.

In regions of infrequent earthquake occurrence where buildings with poorly delineated or weak structural systems are likely to represent a large portion of the building inventory, the upper-bound approach may actually be unconservative. If nearly all buildings are deemed hazardous, the likely policy is inaction.

In regions where earthquakes occur in intervals measured in centuries, there is a need for a simple evaluation method that focuses on selection of buildings with high vulnerability rather than those with a high probability of survival. Because seismic risk evaluation methods are based on concepts that are not all well understood, a procedure designed to identify buildings with a high probability of survival cannot be adapted conveniently to identify buildings with a high probability of failure simply by relaxing some of its requirements.

Undeniably, there is no better vehicle for identifying a vulnerable building than the considered judgment of an experienced professional. But this is an expensive vehicle, especially in regions of infrequent earthquakes. There is a need to provide reasonably objective criteria to be used for initial filtering of the building inventory. These criteria need to be at a very low level of sophistication in deference to the principle of proportionality. The required levy of calculation has to be proportional to the quality of input.

The readily accessible data for an existing building are the dimensions and arrangement of its structural elements and the floor area. The challenge is to determine whether these properties alone may be used to determine the seismic vulnerability of a building inventory at a given location.

In a paper related to damage caused by the Tokachi-Oki earthquake of 1968, Shiga, Shibata, and Takahashi

presented a format (referred to as the SST Format in following text) for evaluating the seismic safety of low-rise monolithic construction in reinforced concrete. They defined the critical attribute for seismic vulnerability to be the weight of the structure divided by the sum of the cross-sectional areas of the walls and the columns.

The SST format is very attractive. The required data are easily acquired. The needed calculation is not time consuming. The result is crisp. But the application of the SST Format in general is questionable because it was derived explicitly in relation to a group of buildings with well-reinforced walls dominating lateral resistance.

Recalibrating or testing the SST format on the basis of theory or experiment is not productive because the procedure needs to be tested on the basis of responses that defy calculation and organized experiment. The procedure has to be tested against observed phenomena in a collection of buildings with dimensional and material properties based on random decisions in construction.



An opportunity for recalibrating the SST format was provided by the Erzincan earthquake of 1992. After the earthquake, the Ministry of Housing and Natural Disasters of the Turkish Republic sponsored the Middle East Technical University (METU), Ankara, to document the damage to 46 institutional building units in Erzincan. The METU team also developed floor plans of the buildings inspected. The body of information assembled by engineers from METU will be referred to as METU data.

Caribbean Disaster Mitigation Project


Implemented by the Organization of American States
Unit of Sustainable Development and Environment
for the USAID Office of Foreign Disaster Assistance and the Caribbean Regional
Program




The Natural Hazards Project component was financed by the European Community
Humanitarian Office (ECHO)
OAS-ECHO School Vulnerability Reduction Program

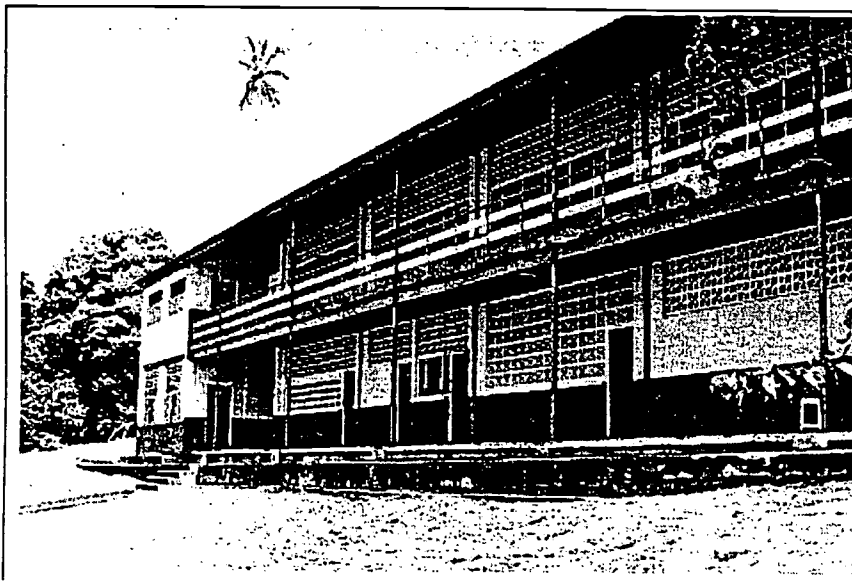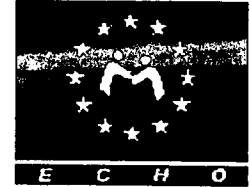


**St. David's R.C.
School
St. David's, Grenada**

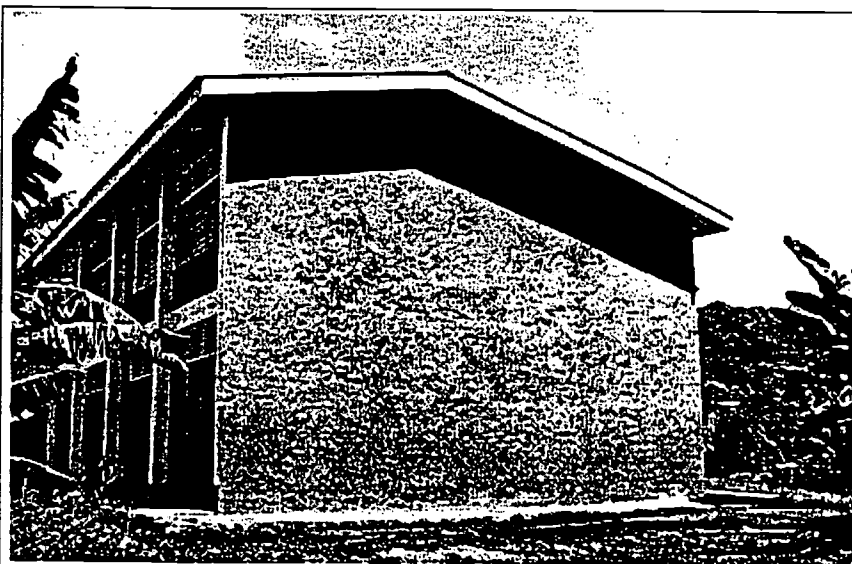


**Pomme Rose R.C.
School
St. David's, Grenada**

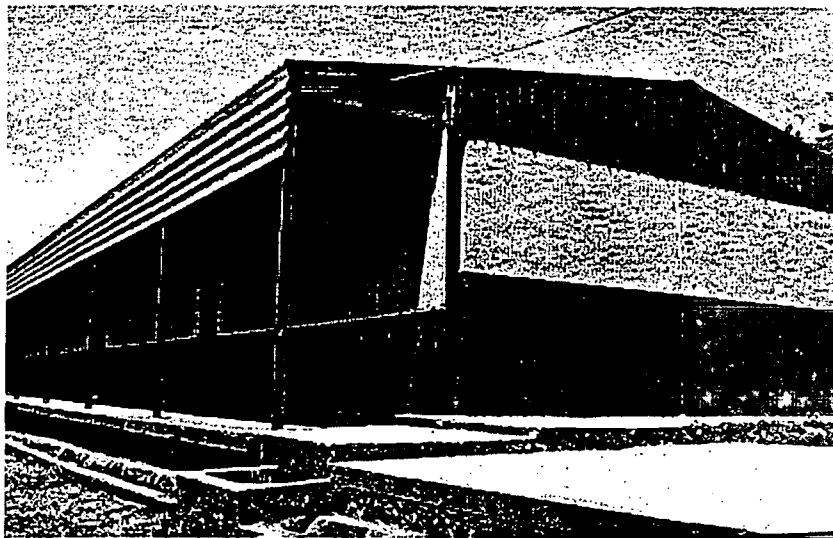

**Crochu R.C. School
St. David's, Grenada**

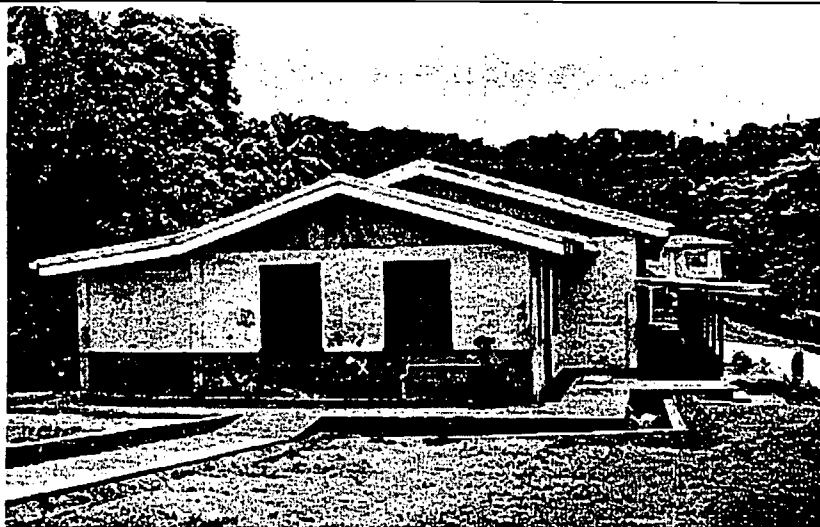


**St. Giles Anglican
School
St. Andrew's,
Grenada**

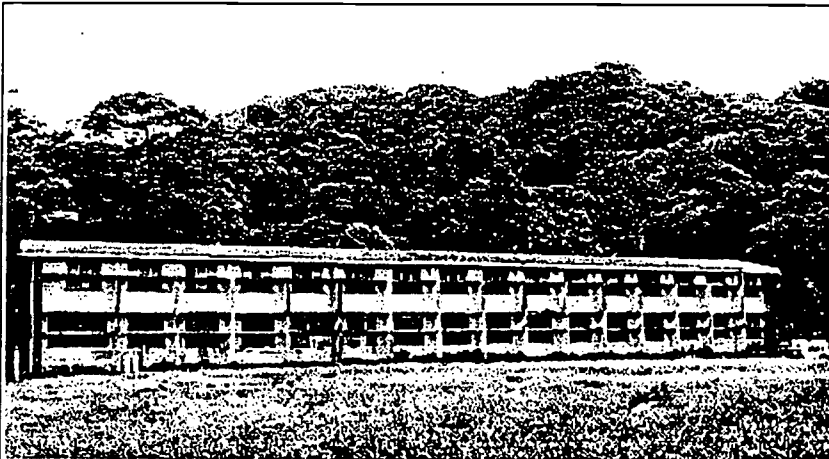


**Holy Cross R.C.
School
St. Andrew's,
Grenada**




**Belair Government
School
St. Andrew's,
Grenada**

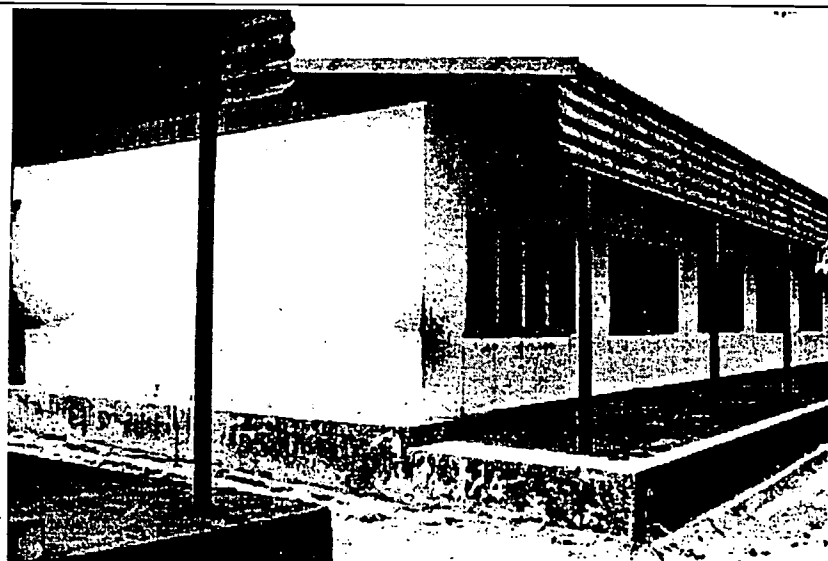


**Paraclete Government
School
St. Andrew's,
Grenada**

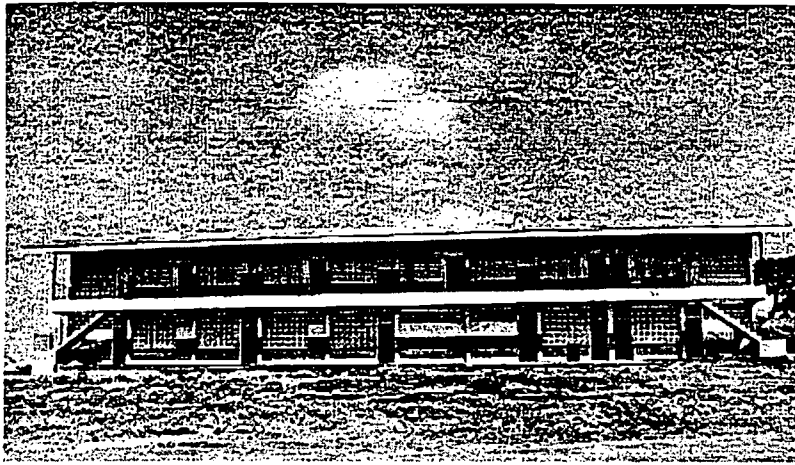

**Calliste Government
School
St. George's, Grenada**

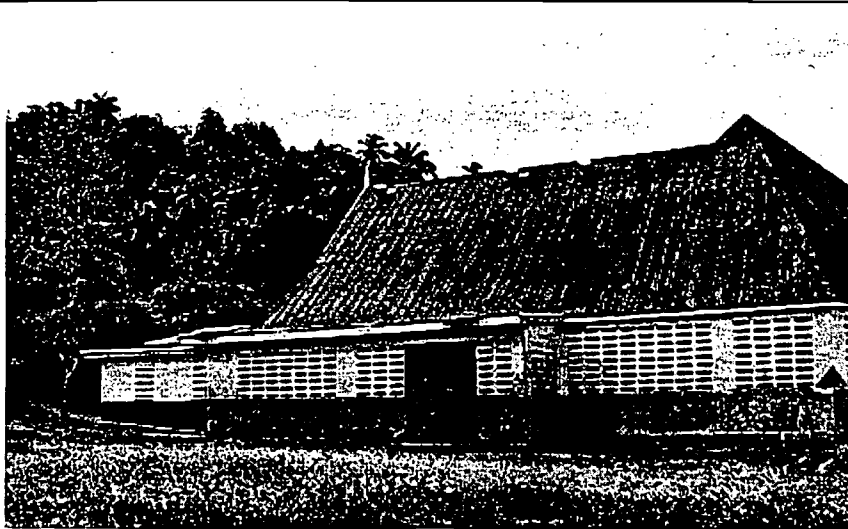


**St. Paul's Government
School
St. George's, Grenada**

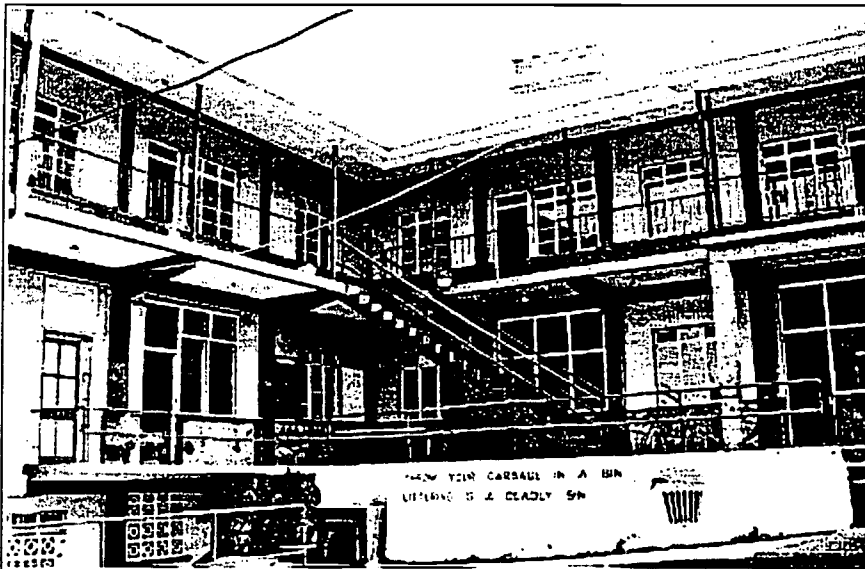

**St. Louis R.C. School
St. George's, Grenada**



**South St. George
Government School
St. George's, Grenada**

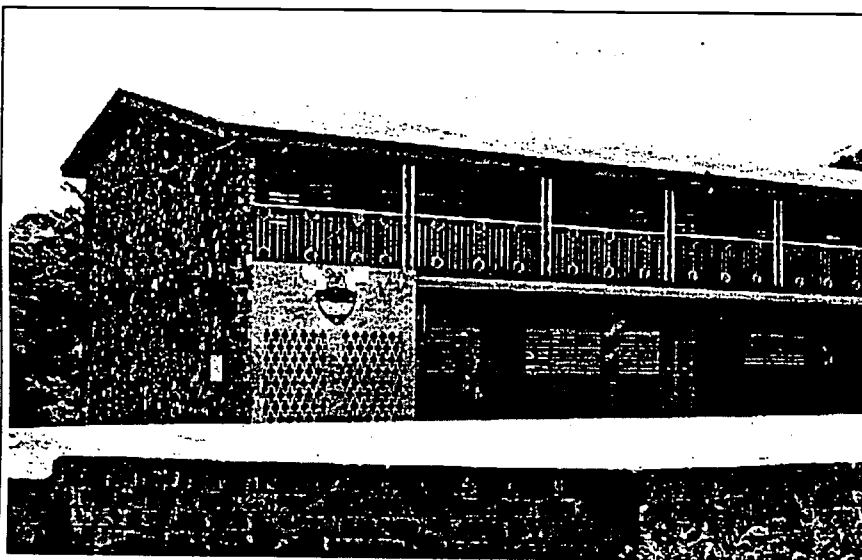


**Mt. Rose
Comprehensive
School
St. Patrick's, Grenada**




**St. Patrick's Anglican
School
St. Patrick's, Grenada**



**Loretto Government
School
St. John's, Grenada**

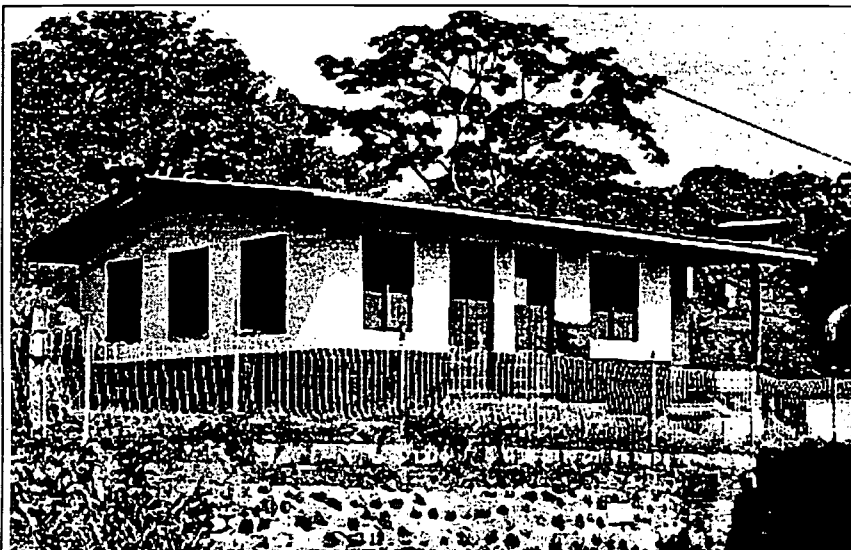

**Concord Government
School
St. John's, Grenada**

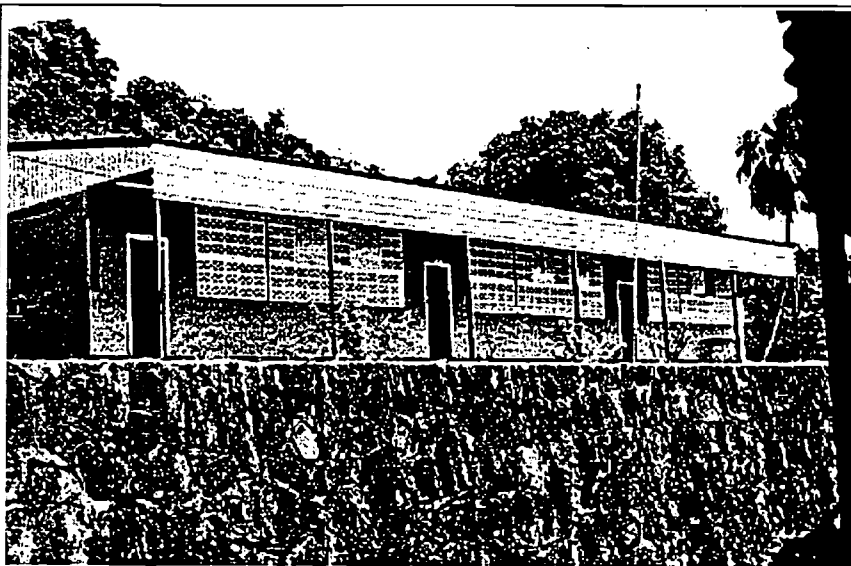

**St. Mark's Secondary
School
St. Mark's, Grenada**



U.S. Department of Education
Office of Educational Research and Improvement (OERI)
National Library of Education (NLE)
Educational Resources Information Center (ERIC)



NOTICE

REPRODUCTION BASIS



This document is covered by a signed "Reproduction Release (Blanket)" form (on file within the ERIC system), encompassing all or classes of documents from its source organization and, therefore, does not require a "Specific Document" Release form.



This document is Federally-funded, or carries its own permission to reproduce, or is otherwise in the public domain and, therefore, may be reproduced by ERIC without a signed Reproduction Release form (either "Specific Document" or "Blanket").